


PRUŽINY

Tlačné pružiny

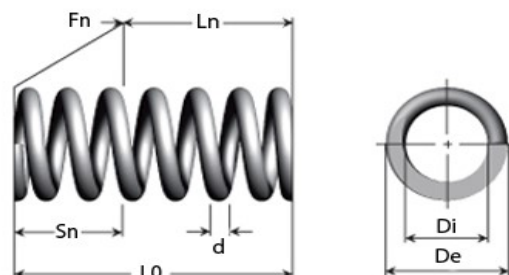

TLAČNÉ PRUŽINY						
Průměr drátu d (mm)	Vnější průměr pružiny De (mm)	Délka pružiny v nezátíženém stavu L0 (mm)	Délka pružiny při max. deformaci Ln (mm)	Počet z závitů z	Síla potřebná pro max. deformaci pružiny Fn (N)	Tuhost pružiny c (N/mm)
1,4	10,4	17,0	8,5	5	130,50	15,34
		25,0	11,6	7		9,76
		37,0	16,3	10		6,32
		53,0	22,6	14		4,29
		77,0	32,0	20		2,90
	12,9	22,0	7,6	5	105,70	7,35
		33,0	10,4	7		4,68
		49,0	14,1	10		3,03
		71,0	19,7	14		2,06
		104,5	28,5	20		1,39
	15,4	30,5	10,0	5	83,70	4,07
		46,5	14,2	7		2,59
		70,0	20,1	10		1,68
		100,5	27,1	14		1,14
		147,5	38,9	20		0,77
	18,9	44,5	12,7	5	66,30	2,09
		68,0	18,1	7		1,33
		102,0	24,8	10		0,86
		152,5	39,0	14		0,58
		222,5	54,5	20		0,39
1,6	9,6	14,5	9,0	5	211,82	37,27
		21,5	12,6	7		23,73
		31,5	17,9	10		15,40
		45,0	24,8	14		10,40
		65,5	35,2	20		7,05
	11,6	18,5	9,4	5	169,66	19,12
		27,0	13,2	7		12,16
		40,5	18,9	10		7,87
		58,5	26,5	14		5,33
		85,0	37,9	20		3,61
	14,1	24,0	10,0	5	135,33	9,76
		36,0	14,1	7		6,23
		53,5	20,1	10		4,04
		78,0	28,0	14		2,73
		115,0	39,9	20		1,84